



CASWELL INC

Safety Data Sheet Swab On Copper Blackener

SECTION 1: Identification

1.1 Product identifier

Product name	Swab On Copper Blackener
Product number	A324
Brand	CASWELL

1.2 Other means of identification

Blue liquid

1.4 Supplier's details

Name	Caswell Inc
Address	7696 Route 31 Lyons NY 14489 USA
Telephone	315 946 1213
Fax	315 946 4456
email	sales@caswellplating.com

1.5 Emergency phone number(s)

Office Hours (9-4ET): 315 946 1213
24 Hour: CHEMTEL US# 1-800-255-3924 Intl# +01-813-248-0585

SECTION 2: Hazard identification

2.1 Classification of the substance or mixture

- Eye damage/irritation (chapter 3.3), Cat. 2A
- Hazardous to the aquatic environment - long-term hazard (chapter 4.1), Cat. 3
- Hazardous to the aquatic environment - acute hazard (chapter 4.1), Cat. 1

2.2 GHS label elements, including precautionary statements

Pictogram

Safety Data Sheet

Swab On Copper Blackener



Signal word

Warning

Hazard statement(s)

H318
H402
H412
H319
H400

Causes serious eye damage
Harmful to aquatic life
Harmful to aquatic life with long lasting effects
Causes serious eye irritation
Very toxic to aquatic life

Precautionary statement(s)

P260
P264
P280
P301+P330+P331
P303+P361+P353

P363
P304+P340
P310
P321
P305+P351+P338

P405
P501
P270
P301+P310
P330
P273
P201
P202
P308+P313
P337+P313
P391

Do not breathe dust/fume/gas/mist/vapours/spray.
Wash thoroughly after handling.
Wear protective gloves/protective clothing/eye protection/face protection.
IF SWALLOWED: Rinse mouth. Do NOT induce vomiting.
IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water/shower.
Wash contaminated clothing before reuse.
IF INHALED: Remove person to fresh air and keep comfortable for breathing. Immediately call a POISON CENTER/doctor/...
Specific treatment (see info on this label).
IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses if present and easy to do. Continue rinsing.
Store locked up.
Dispose of contents/container per local regulations
Do not eat, drink or smoke when using this product.
IF SWALLOWED: Immediately call a POISON CENTER/doctor/...
Rinse mouth.
Avoid release to the environment.
Obtain special instructions before use.
Do not handle until all safety precautions have been read and understood.
IF exposed or concerned: Get medical advice/attention.
If eye irritation persists: Get medical advice/attention.
Collect spillage.

SECTION 3: Composition/information on ingredients

3.2 Mixtures

Hazardous components

1. WATER OR OTHER NON-REPORTABLE INGREDIENTS

Concentration < 74 - 74 % (weight)
CAS no. 7732-18-5

2. Phosphoric acid liquid

Concentration < 10 - 10 % (weight)
EC no. 231-633-2
CAS no. 7664-38-2

Safety Data Sheet

Swab On Copper Blackener

Index no. 015-011-00-6

- Skin corrosion/irritation (chapter 3.2), Cat. 1B

H314 Causes severe skin burns and eye damage

3. Methanol

Concentration < 7 - 7 % (weight)

EC no. 200-659-6

CAS no. 67-56-1

Index no. 603-001-00-X

- Flammable liquids (chapter 2.6), Cat. 2

- Acute toxicity (chapter 3.1), Cat. 3

- Specific target organ toxicity following single exposure (chapter 3.8), Cat. 1

H225 Highly flammable liquid and vapor

H301 Toxic if swallowed

H311 Toxic in contact with skin

H331 Toxic if inhaled

H370 Causes damage to organs [organs, route]

4. MOLYBDENUM TRIOXIDE

Concentration < 3 - 3 % (weight)

EC no. 215-204-7

CAS no. 1313-27-5

Index no. 042-001-00-9

- Specific target organ toxicity following repeated exposure (chapter 3.9), Cat. 2

- Serious eye damage/eye irritation (chapter 3.3), Cat. 2

- Specific target organ toxicity following single exposure (chapter 3.8), Cat. 3

H319 Causes serious eye irritation

H335 May cause respiratory irritation

H373 May cause damage to organs [organs] through prolonged or repeated exposure [route]

5. Copper powder

Concentration < 4 - 6 % (weight)

CAS no. 7440-50-8

6. SELENIOS ACID

Concentration < 2 - 3 % (weight)

CAS no. 7783-00-8

SECTION 4: First-aid measures

4.1 Description of necessary first-aid measures

Safety Data Sheet

Swab On Copper Blackener

General advice	Substance can cause severe skin, eye and respiratory tract irritation/irritation. Corrosive. Will cause eye burns and permanent tissue damage.
If inhaled	If breathed in, move person into fresh air. If not breathing, give artificial respiration. Consult a physician.
In case of skin contact	Wash off with soap and plenty of water. Consult a physician.
In case of eye contact	Rinse thoroughly with plenty of water for at least 15 minutes and consult a physician.
If swallowed	Do NOT induce vomiting. Never give anything by mouth to an unconscious person. Rinse mouth with water. Consult a physician.

SECTION 5: Fire-fighting measures

5.1 Suitable extinguishing media

Use water spray, alcohol-resistant foam, dry chemical or carbon dioxide.

5.2 Specific hazards arising from the chemical

May produce toxic selenious fumes. Reactions with organics and strong reducing agents can produce volatile organoselenides or hydrogen selenide.

SECTION 6: Accidental release measures

6.1 Personal precautions, protective equipment and emergency procedures

SMALL SPILLS: Contain and absorb with absorbent material and place into containers for later disposal. Wash site of spillage thoroughly with water. LARGE SPILLS: Dike far ahead of spill to prevent further movement. Recover by pumping or by using a suitable absorbent material and place into containers for later disposal. Dispose in suitable waste container.

SECTION 7: Handling and storage

7.1 Precautions for safe handling

Keep container tightly closed in a dry and well-ventilated place. Containers which are opened must be carefully resealed and kept upright to prevent leakage.

SECTION 8: Exposure controls/personal protection

8.1 Control parameters

1. Copper, Fume (as Cu) (CAS: 7440-50-8)

PEL (Inhalation): 0.1 mg/m³ (OSHA)

OSHA Annotated Table Z-1, www.osha.gov

PEL (Inhalation): 0.1 mg/m³ (Cal/OSHA)

OSHA Annotated Table Z-1, www.osha.gov

REL (Inhalation): 0.1 mg/m³ (NIOSH)

OSHA Annotated Table Z-1, www.osha.gov

2. Copper, Dusts and mists (as Cu) (CAS: 7440-50-8)

PEL (Inhalation): 1 mg/m³ (OSHA)

OSHA Annotated Table Z-1, www.osha.gov

PEL (Inhalation): 1 mg/m³ (Cal/OSHA)

Safety Data Sheet

Swab On Copper Blackener

OSHA Annotated Table Z-1, www.osha.gov

REL (Inhalation): 1 mg/m³ (NIOSH)

OSHA Annotated Table Z-1, www.osha.gov

3. Phosphoric acid (CAS: 7664-38-2)

PEL (Inhalation): 1 mg/m³ (OSHA)

OSHA Annotated Table Z-1, www.osha.gov

PEL (Inhalation): 1 mg/m³, (ST) 3 mg/m³ (Cal/OSHA)

OSHA Annotated Table Z-1, www.osha.gov

REL (Inhalation): 1 mg/m³, (ST) 3 mg/m³ (NIOSH)

OSHA Annotated Table Z-1, www.osha.gov

4. METHYL ALCOHOL (CAS: 67-56-1 EC: 200-659-6)

PEL-TWA: 200 ppm (ACGIH)

Headache, Nausea, Dizziness, Eye damage Substances for which there is a Biological Exposure Index or Indices (see BEI® section) Danger of cutaneous absorption

STEL: 250 ppm (ACGIH)

PEL-TWA: 200 ppm, 325 mg/m³ (NIOSH)

Potential for dermal absorption

PEL-TWA: 200 ppm, 260 mg/m³ (OSHA)

USA. Occupational Exposure Limits

(OSHA) - Table Z-1 Limits for Air

Contaminants

PEL (Inhalation): 200 ppm (OSHA)

OSHA Annotated Table Z-1, www.osha.gov

PEL (Inhalation): 260 mg/m³ (OSHA)

OSHA Annotated Table Z-1, www.osha.gov

PEL (Inhalation): 200 ppm, (ST) 250 ppm, (C) 1000 ppm (Cal/OSHA)

OSHA Annotated Table Z-1, www.osha.gov

REL (Inhalation): 200 ppm, (ST) 250 ppm (NIOSH)

OSHA Annotated Table Z-1, www.osha.gov

8.3 Individual protection measures, such as personal protective equipment (PPE)

Pictograms



Eye/face protection

Use equipment for eye protection tested and approved under appropriate government standards such as NIOSH (US) or EN 166(EU).

Skin protection

Wear chemical resistant gloves and clothing.

Respiratory protection

NIOSH/MSHA approved air purifying respirator with an organic vapor cartridge or canister may be permissible under certain circumstances where airborne concentrations are expected to exceed exposure limits.

Safety Data Sheet

Swab On Copper Blackener

SECTION 9: Physical and chemical properties

Information on basic physical and chemical properties

Appearance/form (physical state, color, etc.)	Blue Liquid
Odor	Odorless
Odor threshold	
pH	1.68
Melting point/freezing point	
Initial boiling point and boiling range	212 deg F
Flash point	
Evaporation rate	1
Flammability (solid, gas)	
Upper/lower flammability limits	
Vapor pressure	20
Vapor density	Approx equal to water
Relative density	1.055
Solubility(ies)	Soluble In Water
Partition coefficient: n-octanol/water	
Auto-ignition temperature	
Decomposition temperature	
Viscosity	
Explosive properties	
Oxidizing properties	

SECTION 10: Stability and reactivity

10.2 Chemical stability

Stable

10.5 Incompatible materials

Cyanides, organic solvents, strong reducing agents

SECTION 11: Toxicological information

Information on toxicological effects

Acute toxicity

not available

SECTION 12: Ecological information

Toxicity

not available

SECTION 13: Disposal considerations

Disposal of the product

Consult appropriate federal and local regulations for disposal. Empty containers are subject to the same regulations.

SECTION 14: Transport information

Safety Data Sheet

Swab On Copper Blackener

DOT (US)

UN Number: UN1760

Class: 8

Packing Group: II

Proper Shipping Name: Corrosive Liquid, NOS (Phosphoric Acid, Selenious Acid)

Reportable quantity (RQ): 335 lbs

Small quantities may be shipped as Limited Quantities. Consult 49 CFR.

IMDG

UN Number:

Class:

Packing Group:

EMS Number:

Proper Shipping Name:

IATA

UN Number: UN1760

Class: 8

Packing Group: II

Proper Shipping Name: Corrosive Liquid, NOS (Phosphoric Acid, Selenious Acid)

SECTION 15: Regulatory information

15.1 Safety, health and environmental regulations specific for the product in question

Massachusetts Right To Know Components

Chemical name: Selenious acid

CAS number: 7783-00-8

New Jersey Right To Know Components

Common name: SELENOUS ACID

CAS number: 7783-00-8

Pennsylvania Right To Know Components

Chemical name: Selenous acid

CAS number: 7783-00-8

Massachusetts Right To Know Components

Chemical name: Copper

CAS number: 7440-50-8

New Jersey Right To Know Components

Common name: COPPER

CAS number: 7440-50-8

Pennsylvania Right To Know Components

Chemical name: Copper

CAS number: 7440-50-8

Massachusetts Right To Know Components

Chemical name: Nitric acid

CAS number: 7697-37-2

New Jersey Right To Know Components

Common name: NITRIC ACID

CAS number: 7697-37-2

Pennsylvania Right To Know Components

Chemical name: Nitric acid

Safety Data Sheet

Swab On Copper Blackener

CAS number: 7697-37-2

Massachusetts Right To Know Components

Chemical name: Phosphoric acid

CAS number: 7664-38-2

New Jersey Right To Know Components

Common name: PHOSPHORIC ACID

CAS number: 7664-38-2

Massachusetts Right To Know Components

Chemical name: Methanol

CAS number: 67-56-1

New Jersey Right To Know Components

Common name: METHYL ALCOHOL

CAS number: 67-56-1

Pennsylvania Right To Know Components

Chemical name: Methanol

CAS number: 67-56-1

California Prop. 65 components

Chemical name: Methanol

CAS number: 67-56-1

03/16/2012 - Developmental toxicity

Massachusetts Right To Know Components

Chemical name: Molybdenum trioxide

CAS number: 1313-27-5

New Jersey Right To Know Components

Common name: MOLYBDENUM TRIOXIDE

CAS number: 1313-27-5

Pennsylvania Right To Know Components


Chemical name: Molybdenum trioxide

CAS number: 1313-27-5

HMIS Rating

Swab On Copper Blackener	
HEALTH	* 2
FLAMMABILITY	0
PHYSICAL HAZARD	0
PERSONAL PROTECTION	C

NFPA Rating

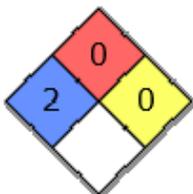

SECTION 16: Other information

Safety Data Sheet

Swab On Copper Blackener

16.1 Further information/disclaimer

DISCLAIMER: The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigation to determine the suitability of information for their particular purposes. In no event shall Caswell Inc be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, whatsoever arising, even if Caswell Inc has been advised of the possibility of such damages.

16.2 Preparation information

L CASWELL